



**TDS**

**MXBON<sup>®</sup> 703**

GENERAL PURPOSE (Metal)

**PRODUCT SPECIFICATION**

**MXBON® 703**

**Cyanoacrylate Adhesive (Metal)**

**Description:**

MXBON® 703 is a general purpose adhesive and is especially formulated for bonding metal substrates. MXBON® 703 has a longer setting time than regular Cyanoacrylate adhesive and it allows enough time for users to put materials together after application. It has been specially formulated to achieve the strongest possible bond between well-mated metal substrates. MXBON® 703 is a one-component, solvent-free system and does not require the use of a catalyst, heat or clamps. When a thin layer of MXBON® 703 applied between two surfaces comes into contact with atmospheric moisture, a rapid polymerization occurs producing the ultimate bond.


**Typical Properties of Cured/Uncured Material:**

Uncured State		Cured State Physical Properties	
Base	Methyl Cyanoacrylate	Colour	Clear
Colour	Clear	Coefficient of Thermal Expansion (K <sup>-1</sup> )	100 x 10 <sup>-6</sup>
Specific Gravity (25°)	1.10	Coefficient of Thermal Conductivity (W/m.K)	0.10
Refraction Index (nD <sup>20</sup> )	1.439	Softening Point (°C)	165°C
Flash Point (°C)	See SDS	Cured State Electrical Properties	
Vapour Pressure (hPa)	<1	Volume Resistivity (Ω.cm)	2 x 10 <sup>15</sup> - 10 x 10 <sup>15</sup>
Viscosity (cP) @ 25°C	100-200	Surface Resistivity (Ω)	10 x 10 <sup>15</sup> - 80 x 10 <sup>15</sup>
Shelf Life	12 months	Dielectric Constant @ 10kHz	2.5
Storage Life Below 5°C	12-18 months	Dielectric Dissipation Factor @ 10kHz	<0.02
		Dielectric Breakdown Strength (kV/mm)	25

**Curing Performance:**

There are many factors that can influence the rate of cure. These include: the types of substrate used, the Condition of the surface to be bonded, the smoothness of the surface, the closeness of the surfaces and the atmospheric conditions.

SUBSTRATE	CURE SPEED SECONDS
Steel to Steel	30-60
Stainless Steel to Stainless Steel	30-60
Aluminum to Aluminum	45-80
Zinc Plated to Zinc Plated	30-90
ABS to ABS	10-30
ABS to NBR	10-15
ABS to Wood	10-20
NBR to NBR	3-10
Polycarbonate	30-90

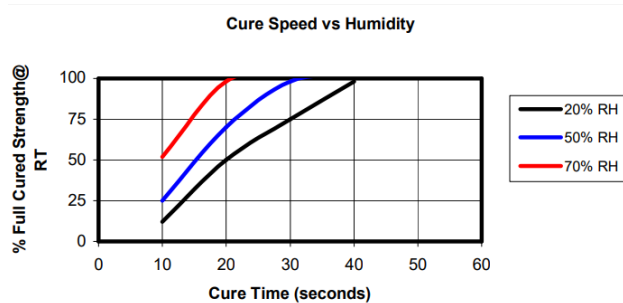

## PRODUCT SPECIFICATION

# MXBON<sup>®</sup> 703


## Cyanoacrylate Adhesive (Metal)

### Bond Strength:


(TENSILE STRENGTH, CURED FOR 24 HOURS AT 20-25°)

SUBSTRATE	KG/CM <sup>2</sup>
Steel to Steel	190-210
Stainless Steel to Stainless Steel	250-450
Aluminum to Aluminum	170-190
Copper to Copper	150-170
PVC to PVC	40-60
ABS to ABS	50-70
Polycarbonate to Polycarbonate	80-120
Polystyrene	30-45
NBR to NBR	5-9
SBR to SBR	5-10

Hot Strength, tested at temperature

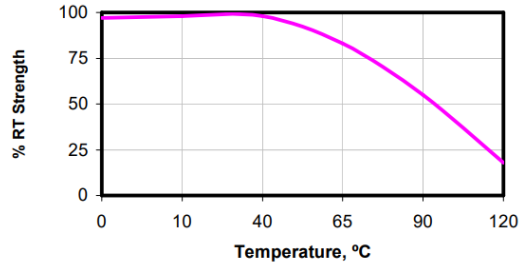

Aged and tested at temperature

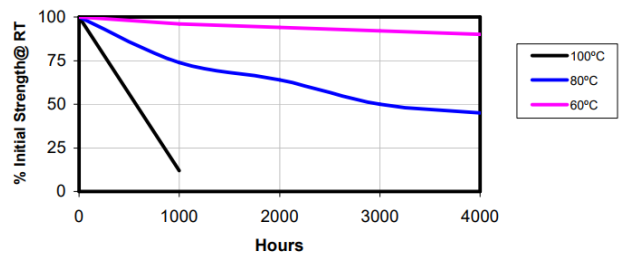

## Directions For Use:

1. Make sure the surfaces to be bonded are clean and dry (preferable to solvent-wipe plastics, glass, rubber and to acid-treat metals).
2. Dispense a drop or drops to one surface only. Apply only enough to leave a thin film after compression.
3. Press parts together and hold firmly for a few seconds. Good contact is essential. An adequate bond develops in less than one minute. (Maximum strength is achieved in 24 to 48 hours).
4. Wipe off excess adhesive from the top of the container and recap. **MXBON<sup>®</sup> 703** if left uncapped, may deteriorate by contamination from moisture in the air.
5. Because **MXBON<sup>®</sup> 703** polymerises on contact with moisture surfaces, sometimes whitening will occur on the surface of the container or the bonded materials. Should this happen, wipe surfaces well with debonder.

## Handling & Storage

**Storage:** Keep products in the unopened container in a cool dry location. The product is best when stored at 2 to 8°C. temperatures less than 2°C can adversely affect product properties. Do not freeze. Keep container tightly closed until ready for use.

**Handling:** Material removed from containers may be contaminated during use. Do not pour back any product to the original Container. Misuse of product will void all warranties.

## Precaution

1. Use with proper ventilation. Avoid contact with skin and eyes.
2. If contact with skin occurs, rinse with warm water or dissolve with appropriate debonder. Do not try to remove forcibly.
3. If adhesive gets into your eye, keep eye open and rinse thoroughly. Seek medical attention immediately.
4. Keep well out of reach of children.
5. Keep adhesive in a cool dry place 20-25°C. For long term storage, refrigeration (5°C) is recommended.

## Disclaimer:

The data contained herein are furnished for informational purposes only and are believed to be reliable. However, Cartell UK Ltd does not assume responsibility for any results obtained by persons who methods Cartell UK Ltd has no control. It is the responsibility to determine the suitability of Cartell UK's products or any production methods mentioned herein for a particular purpose, and to adopt such precautions as may be advisable for the protection of property and persons against any hazards that may be involved in the handling and use of any Cartell UK Ltd's products. Cartell UK Ltd specifically disclaims all warranties express or implied, including warranties of salability and suitability for a particular purpose arising from sale or use of Cartell UK Ltd's products. Cartell UK Ltd further disclaims any liability for consequential or incremental damages of any kind including lost profits.